	ACTION		EQUIP/FUNCTION LOST	CREW INDICATION	NOTES
			RPCM N1RS2 A (Type V)	Caution Messages:	1)String B of the Node 1 and PMA 1 shell heaters are nominally primary.
1	If during Node 1 Pre-Ingress Warm-up, Ingress, or Post Egress Dryout  • √MCC-H for heater configuration		Node1 Shell Htrs String B	Advisory Messages:  RPCM N1RS2_A Loss of Comm - NOD1  Telemetry:	Since the internal Early Comm equipment is lost, the entire Early Comm system is lost. Power to the Port and Stbd antenna is removed.
	PCS Node1:TCS   NODE1'   • sel Node 1 Htr [X] A   [X] = [1] [2] [3] [4] [5] [6]   [7] [8] [9]   • cmd Ena Opr Execute   • Repeat			PCS Node1: EPS Node1: EPS RPCM N1RS2 A - not Active	(3) Normally the CBMs are powered off.
	Node1: EPS: RPCM N1RS1  RPCM NIRS1 C  • sel RPCM Detail • sel RPC [X], [X] = [5] [12] • cmd Open Execute • Repeat	3	CBM N1 Stbd Pri 1 (Early Comm Transceiver Pwr & Htr) CBM N1 Stbd Pri 2 (Early Comm Spare) CBM N1 Stbd Pri 3 (Early Comm CTP) CBM N1 Stbd Pri 4 (Early Comm RFPDB)		
	On MCC Go: Perform RPCM Remove and Replace Procedure (SODF: OSO)				